


STANDARD ACCESSORIES FOR HEADER TANKS

COLLAR BRACKETS

8"

Our most popular Brackets for fastening the tank versatile, practical and efficient

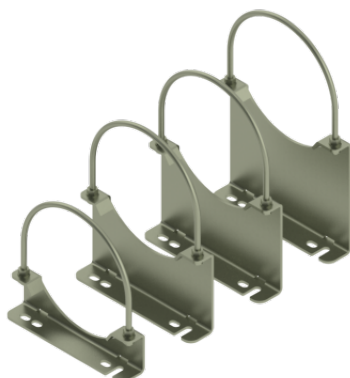

PRODUCT CERTIFICATIONS

STANDARD



OPZIONALI




TECHNICAL FEATURES

Code	Height	Weight
ST08-H134	134mm	1.240kg
ST08-H210	210mm	2.015kg
ST08-H230	230mm	2.220kg
ST08-H270	270mm	2.630kg


COLLAR BRACKETS TYPE

COLLAR BRACKETS - 8" HEADER TANK


ST08-H134

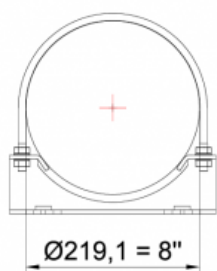




ST08-H210

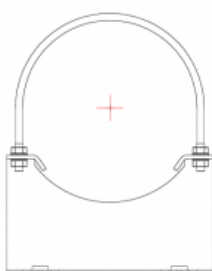

ST08-H230

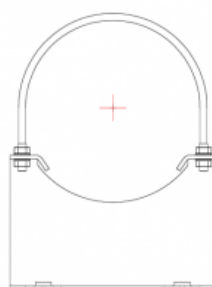


ST08-H270

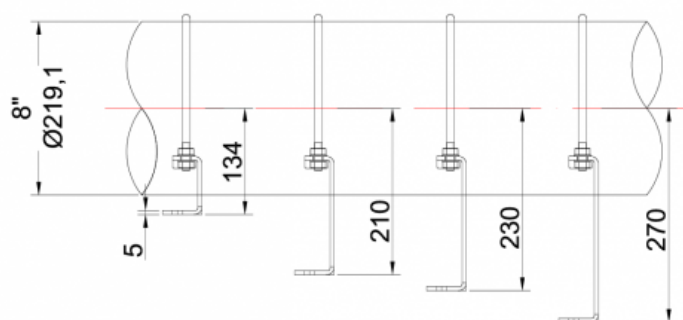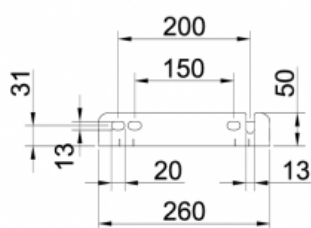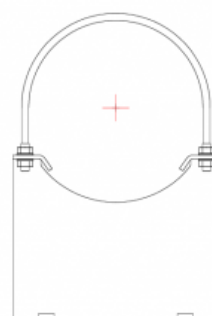

PARTS LIST

No.	Description	Material
1	Collar 8"	CS/ SS
2	Nut M10	CS/ SS
3	Washer	CS/ SS
4	Brackets 8"	CS/ SS

Immagine

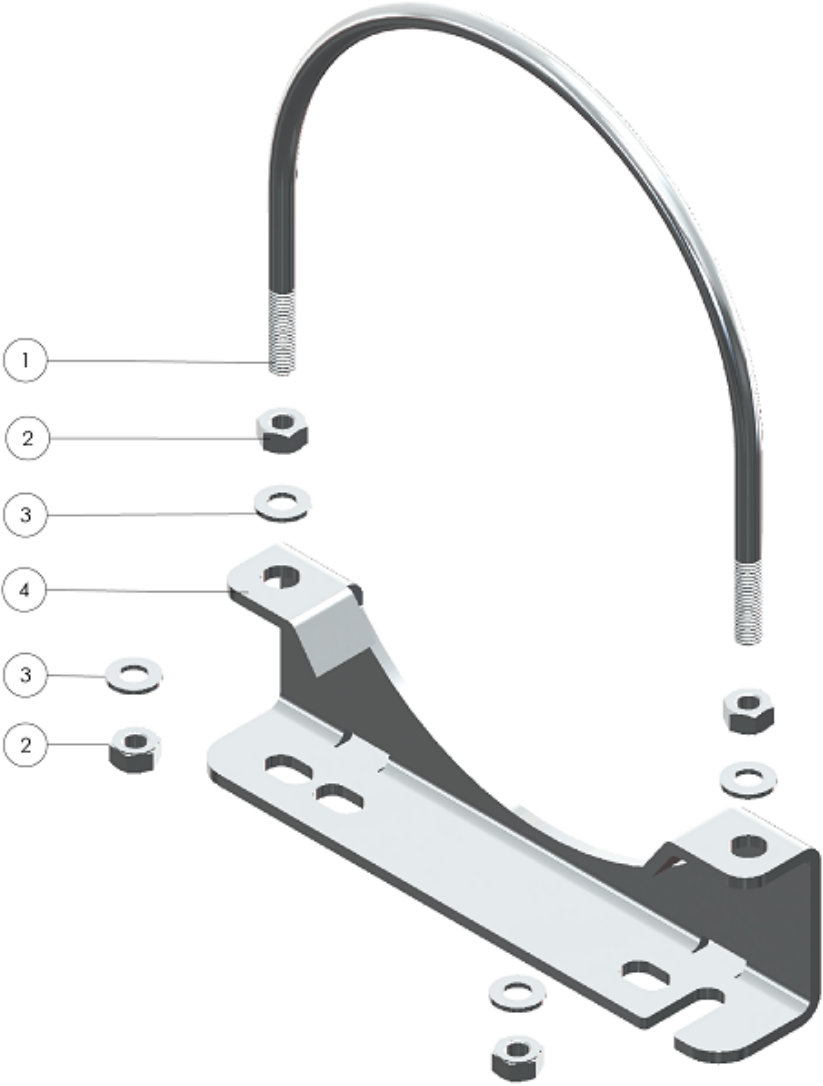


DIMENSIONAL LAYOUT


COLLAR BRACKETS - 8" HEADER TANK

SUGGESTED ASSEMBLING

VALVE TYPE	Ø PIPE	E	D MAX	H
		Tolerance -10 +20	Tolerance -10 +20	
AE1440WTS AE2440WTS	1"1/2	210 mm	461 mm	SEE TABLE 1 PAGE HEIGHT BRACKET
AE1440ITS AE2440ITS	1"1/2	230 mm	478 mm	
AE1440WTL AE2440WTL	1"1/2	270 mm	521 mm	
AE1440ITL AE2440ITL	1"1/2	280 mm	527 mm	

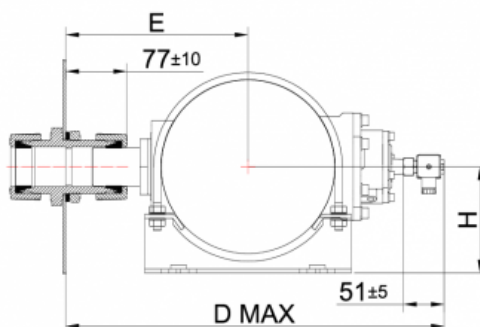

VALVE TYPE	Ø PIPE	BRACKET TYPE	H	D MAX
AE1440WTS AE2440WTS	1"1/2	ST08-H210	210 mm	461 mm
AE1440ITS AE2440ITS	1"1/2	ST08-H230	230 mm	477 mm
AE1440WTL AE2440WTL	1"1/2	ST08-H270	270 mm	522 mm
AE1440ITL AE2440ITL	1"1/2	ST08-H270	270 mm	517 mm

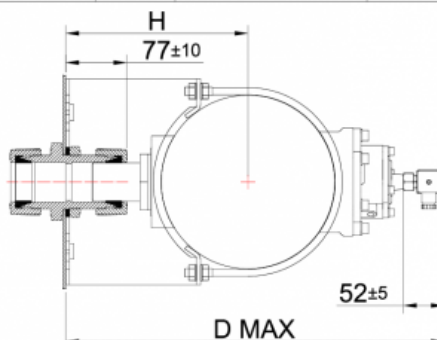


DIMENSIONAL LAY-OUT 2


COLLAR BRACKETS - 8" HEADER TANK

SUGGESTED ASSEMBLING

VALVE TYPE	Ø PIPE	E	D MAX	H
		Tolerance -10 +20	Tolerance -10 +20	
AE1450WTS AE2450WTS	2"	210 mm	472 mm	SEE TABLE 1 PAGE HEIGHT BRACKET
AE1450ITS AE2450ITS	2"	230 mm	487 mm	
AE1450WTL AE2450WTL	2"	270 mm	532 mm	
AE1450ITL AE2450ITL	2"	280 mm	537 mm	

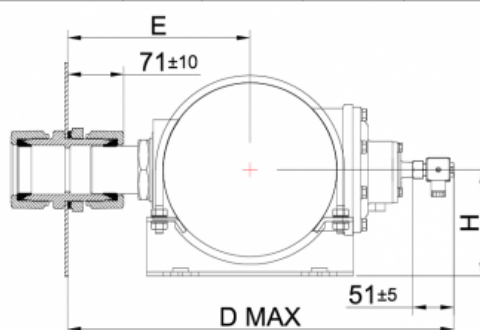


VALVE TYPE	Ø PIPE	BRACKET TYPE	H	D MAX
AE1450WTS AE2450WTS	2"	ST08-H210	210 mm	472 mm
AE1450ITS AE2450ITS	2"	ST08-H230	230 mm	487 mm
AE1450WTL AE2450WTL	2"	ST08-H270	270 mm	532 mm
AE1450ITL AE2450ITL	2"	ST08-H270	270 mm	527 mm

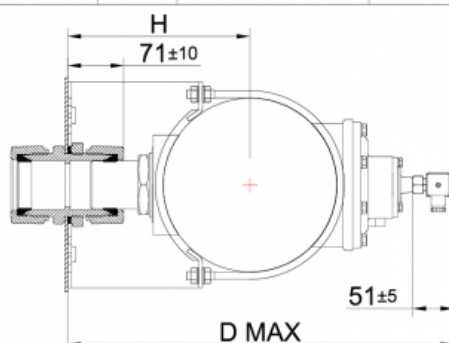

ASSEMBLED INTRUSCTION


COLLAR BRACKETS - 8" HEADER TANK

INSTRUCTIONS FOR ASSEMBLING

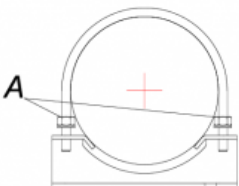


STEP 1

- Insert the U collar on the vessel
- screw the two nuts M10 (A) and then the washer D10 till the end of the thread
- Insert bracket

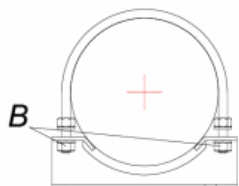

STEP 2

- Insert the washer D10 and the two nut M10 (B)
- Torque at 6Nm/8Nm

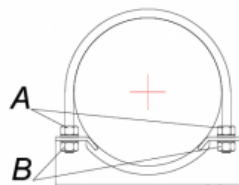

STEP 3

- Screw the nut (A) untill the bracket
- Hold the nut (B)
- Now torque the nut (A) at 40Nm with always the nut (B) holded